




Cambria Environmental Technology, Inc.  
2000 Opportunity Drive, Suite 110  
Roseville, CA  
Telephone: 916.677.3407  
Fax: 916.677.3687

# BORING/WELL LOG

CLIENT NAME	Chevron Environmental Management Company	BORING/WELL NAME	MW-1
JOB/SITE NAME	Chevron Station 9-9527	DRILLING STARTED	01-Dec-05
LOCATION	1515 North Garey Avenue, Pomona, CA	DRILLING COMPLETED	01-Dec-05
PROJECT NUMBER	61H-2150	WELL DEVELOPMENT DATE (YIELD)	09-Dec-05 (54 Gallons)
DRILLER	BC2 Environmental Corp.	GROUND SURFACE ELEVATION	925.01 ft above msl
DRILLING METHOD	Hollow-stem auger	TOP OF CASING ELEVATION	924.56 ft above msl
BORING DIAMETER	8	SCREENED INTERVAL	24 to 54 ft bgs
LOGGED BY	Dave Boggs	DEPTH TO WATER (First Encountered)	35.0 ft (01-Dec-05)
REVIEWED BY	L. Lowry, PG# 7870	DEPTH TO WATER (Static)	30.2 ft (09-Dec-05)
REMARKS	Cleared to 7 fbg using air knife.		

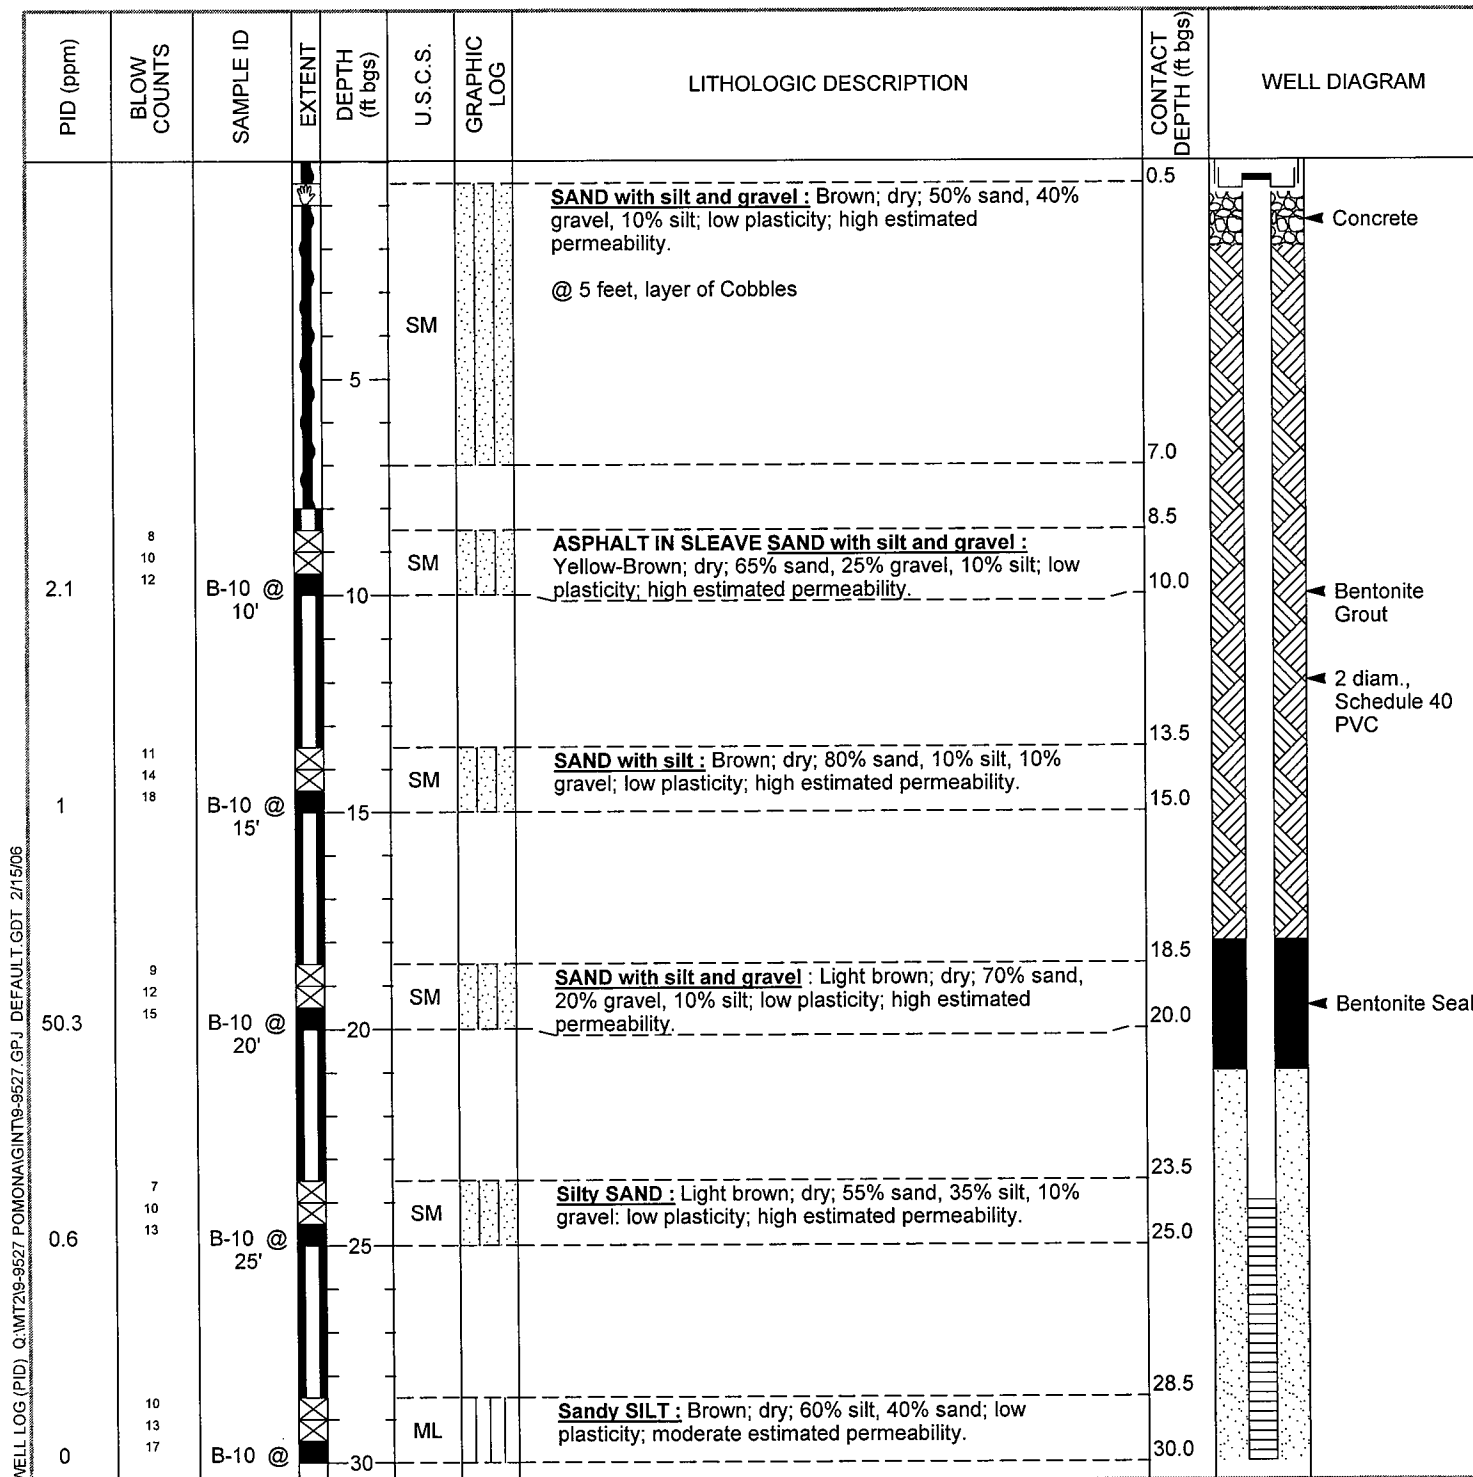

Continued Next Page



Cambria Environmental Technology, Inc.  
2000 Opportunity Drive, Suite 110  
Roseville, CA  
Telephone: 916.677.3407  
Fax: 916.677.3687

# BORING/WELL LOG

CLIENT NAME	Chevron Environmental Management Company	BORING/WELL NAME	MW-1
JOB/SITE NAME	Chevron Station 9-9527	DRILLING STARTED	01-Dec-05
LOCATION	1515 North Garey Avenue, Pomona, CA	DRILLING COMPLETED	01-Dec-05

Continued from Previous Page

PID (ppm)	BLOW COUNTS	SAMPLE ID	EXTENT DEPTH (ft bgs)	U.S.C.S.	GRAPHIC LOG	LITHOLOGIC DESCRIPTION	CONTACT DEPTH (ft bgs)	WELL DIAGRAM
		30'						
	7 9 12			ML		<b>Sandy SILT</b> : Brown; wet; 60% silt, 40% sand; low plasticity; moderate estimated permeability.	33.5 35.0	
	7 9 12			SM		<b>Silty SAND</b> : Brown; wet; 60% sand, 35% silt, 5% gravel; low plasticity; high estimated permeability.	38.5 40.0	Monterey Sand #3 2-diam., 0.010 Slotted Schedule 40 PVC
						No Recovery.	43.5 45.0	
						No Recovery.	48.5 50.0	
							54.0	Bottom of Boring @ 54 ft